

HPA Conformal Coating

Product Code: HPA

PRODUCT DESCRIPTION

High Performance Acrylic Conformal Coating is a flexible transparent acrylic coating for the protection of electronic circuitry formulated to meet the highest defence and aerospace requirements. **HPA** is designed to be removed with **Electrolube Ultrasolve** (100% Ozone Friendly). **HPA** is approved to US MIL-1-46058C, Qualification Reference 46058-562-90; and is 100% Ozone Friendly in both aerosol and bulk form.

FEATURES

- * Excellent adhesion under all climatic conditions.
- * Fluoresces under UV light as an aid to inspection.
- * Wide temperature range -55°C to +130°C.
- * Can be soldered through without fear of highly toxic gases being produced (contains no isocyanates).
- * Non-corrosive to Cadmium and Zinc plate (contains no phenols).
- * Resistant to mould growth.
- * Can be totally removed with **Electrolube Ultrasolve**.
- * Compatible with other high specification acrylic coatings.
- * Excellent Dielectric properties

TYPICAL PROPERTIES

Liquid HPA

Colour:	Pale coloured liquid
Non-volatile content:	35% (Bulk)
Viscosity @ 21°C:	2.4 - 3.7 Poise (Bulk) 2.00 Poise (Aerosol)
Specific Gravity @ 20°C:	0.91 (Bulk) 0.78 (Aerosol)
Flash Point:	-7°C (Bulk) -4°C (Aerosol)
Drying Time:	15-20 min. touch dry 24 hours optimum properties

Cured HPA Coating


Colour:	Transparent
Dielectric Strength:	45 kV/mm
Electrical Resistivity:	1×10^{14} Ohms/cm
Comparative Tracking Index:	>300 V

TECHNICAL
DATA
SHEET



**Copyright
Electrolube
2003**

All information is given in good faith but without warranty. Properties are given as a guide only and should not be taken as a specification. Electrolube cannot be held responsible for the performance of its products within any application determined by the customer, who must satisfy themselves as to the suitability of the product.

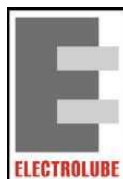

HPA Conformal Coating – Page 2

Temperature Range: -55°C to +130°C
Flammability: Self-extinguishing
Dissipation Factor @ 1MHz @ 25°C: 0.01

DIRECTIONS FOR USE

HPA can be sprayed, dipped or brushed. The thickness of the coating depends on the method of application, but a dip coater normally deposits a film thickness of about 25 microns (single coat). Workshop temperatures of less than 16°C or relative humidities in excess of 75% are unsuitable for the application of **HPA**. All PCBs, being composite materials, absorb moisture. If this is not removed, the conformal coating may not protect to its fullest extent. Pre-drying, or better still, vacuum desiccation, will remove most of the moisture.

HPA contains a UV trace which allows inspection of the PCB after coating to ensure complete and even coverage. The stronger the reflected light, the thicker the coating layer is.

Cleaning

Boards should be thoroughly cleaned before coating. This is required to ensure that satisfactory adhesion to the substrate is possible. Also all flux residues must be removed as they become corrosive if left on the PCB. Electrolube manufacture a range of 100% Ozone Friendly cleaning products in both the hydrocarbon solvent and aqueous fields. All products produce results within the Military specification. Please contact Electrolube for further information.

Dip Coating

Electrolube manufacture an automated **Dip Coating Machine (DCM)** which is ideal for applying all of the **Electrolube** Conformal Coatings including **HPA**.

Ensure that the coating material in the container has been agitated thoroughly and has been allowed to stand for at least 2 hours for all the air bubbles to disperse.


Universal Acrylic Thinners (UAT) should be used to keep the **HPA** coating at a suitable viscosity for dipping (180 – 200cps @20°C). **UAT**

TECHNICAL DATA SHEET



Copyright Electrolube 2003

All information is given in good faith but without warranty. Properties are given as a guide only and should not be taken as a specification. Electrolube cannot be held responsible for the performance of its products within any application determined by the customer, who must satisfy themselves as to the suitability of the product.

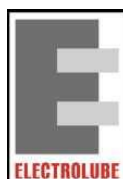

HPA Conformal Coating – Page 3

is added periodically as the solvent evaporates. The viscosity should be checked using a viscosity meter or "flow cup".

The board assemblies should be immersed in the **HPA** dipping tank in the vertical position, or at an angle as close to the vertical as possible. Connectors should not be immersed in the liquid unless they are very carefully masked. **Electrolube Peelable Coating Mask (PCM)** is ideal for this application.

Leave submerged for about 1 minute until the air bubbles have dispersed. The board or boards should then be withdrawn VERY SLOWLY so that an even film covers the surface. After withdrawing, the boards should be left to drain over the tank until the majority of residual coating has left the surface.

After the draining operation is complete, the boards should be placed in an air-circulating drying cabinet and left to dry.

Spraying

Bulk **HPA** needs to be thinned with **UAT** before spraying. The optimum viscosity to give coating quality and thickness depends on the spray equipment and conditions but a starting point could be 1 part coating to 2 parts thinners. If bulk coating material has been agitated, allow to stand until air bubbles have dispersed.

HPA is suitable both for use in manual spray guns and computer controlled airless spray equipment that only coats the required areas of the PCB, eliminating the need for masking.

The nozzle of the spray gun requires to be selected to give an even spray to suit the prevailing viscosity of the coating material. The normal spray gun pressure required is 27.6×10^6 kN/m² to 34.5×10^6 kN/m² (40 - 50 lbs/sq.inch)

To ensure penetration of the coating beneath the components and in confined spaces, spray the assembly from all directions to give an even coating.


After spraying, the boards should be placed in an air-circulating drying cabinet and left to dry.

TECHNICAL DATA SHEET



Copyright Electrolube 2003

All information is given in good faith but without warranty. Properties are given as a guide only and should not be taken as a specification. Electrolube cannot be held responsible for the performance of its products within any application determined by the customer, who must satisfy themselves as to the suitability of the product.

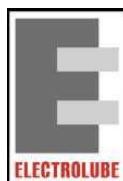

HPA Conformal Coating – Page 4

Brushing

Ensure that the coating material has been agitated thoroughly and has been allowed to settle for at least 2 hours. The coating should be kept at ambient temperature. Gently apply the coating with a good quality brush so as not to leave brush marks and so that the components and wiring are not disturbed.

When the brushing operation is complete the boards should be placed in an air-circulating drying cabinet and left to dry.

Drying Times and Curing Conditions

HPA will be touch dry after 15 - 20 minutes at room temperature and does not require a thermal cure. The full properties of **HPA** will be obtained after a 24 hours at room temperature. This can be accelerated by the use of a thermal cure of 2 hours at 90°C or 4 hours at 60°C.

Double Coating

Two coats of **HPA** are not usually required. However if two coats are required, the second coating should be applied after the first coating is dry. This will ensure that the two coats will bond satisfactorily.

PACKAGING

HPA Conformal Coating

200ml Aerosol (100% Ozone Friendly)
5 Litre Bulk

HPA05L

Universal Acrylic Thinners

5 Litre

ORDER CODE

HPA200H

UAT05L

Removal Solvent

Ultrasolve (100% Ozone Friendly, Flammable)

200ml Aerosol

400ml Aerosol

1 Litre Bulk

5 Litre Bulk

25 Litre Bulk

ULS200D

ULS400D

ULS01L

ULS05L

ULS25L

TECHNICAL
DATA
SHEET



Copyright
Electrolube
2003

All information is given in good faith but without warranty. Properties are given as a guide only and should not be taken as a specification. Electrolube cannot be held responsible for the performance of its products within any application determined by the customer, who must satisfy themselves as to the suitability of the product.

